


CITY OF BALTIMORE WET WEATHER CONSENT DECREE SMOKE AND DYED WATER TESTING FORM		Page 1 of 4
Sewershed: Low Level Subsewershed: 44	Company: REI/DRAYCO	Date: 08/25/2008
Test Type: Smoke	Ground Condition: Dry: X Damp: _ Wet: _	Supervisor: E.R. Crew: 03
Manhole ID: S17K__034MH	Test ID: 1029-553	Notifications Made: __X__ Residents, Fire, 311
Field Sketch: (Show all manholes with numbers, blower placement location, sandbag or isolation locations, street names, building addresses and locations, defect locations and photograph numbers)		

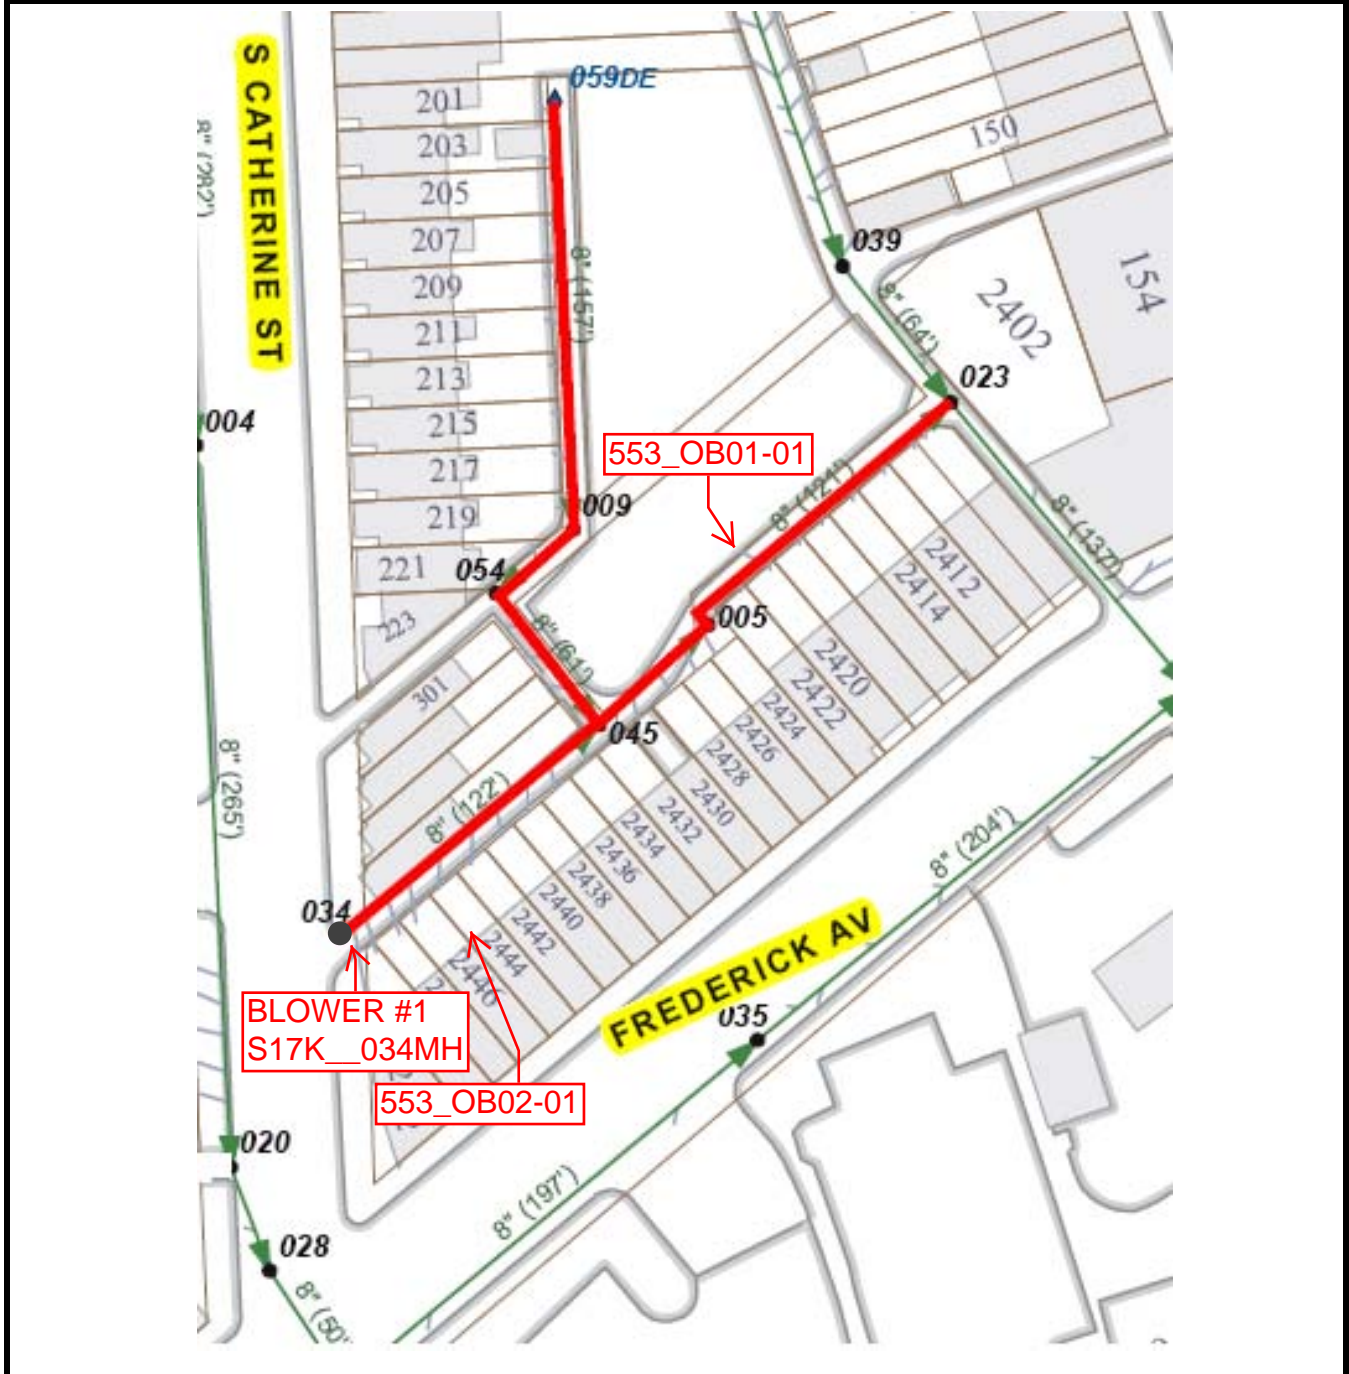

[illegible]

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
LOW LEVEL SEWERSHED
BALTIMORE CITY PROJECT 1029
REI/DRAYCO

Unique Test ID: 553	Date: 08/25/2008	Basin: LL - 44	Manhole ID: S17K__034MH
Defect No: OB01	Supervisor: E.R.	Crew: 03	Dye Test Recommended: N
Location: 2420 FREDERICK AVE.			
Source Type: 02 Service Line		Sector: 01 Public	
Location: 11 Field/Woods		Severity: 03 Moderate	Drainage Area: 2
Comments: SMOKE COMING FROM DAMAGED AND ABANDONED SERVICE LINE AT GRADE ACROSS ALLEY FROM REAR OF 2420 FREDERICK AVE.			

SMOKE TEST PHOTOGRAPHS



Photograph No: OB01-01
Filename: 1029-553_OB01-01.jpg

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
LOW LEVEL SEWERSHED
BALTIMORE CITY PROJECT 1029
REI/DRAYCO

Unique Test ID: 553	Date: 08/25/2008	Basin: LL - 44	Manhole ID: S17K__034MH
Defect No: OB02	Supervisor: E.R.	Crew: 03	Dye Test Recommended: N
Location: 2442 FREDERICK AVE.			
Source Type: 02 Service Line		Sector: 02 Private	
Location: 08 Yard - Back		Severity: 03 Moderate	Drainage Area: 10
Comments: SMOKE COMING FROM GROUND AREA NEAR CLEANOUT AT RESIDENCE.			

SMOKE TEST PHOTOGRAPHS



Photograph No: OB02-01
Filename: 1029-553_OB02-01.jpg